



## Single Ply Roofing Systems (EPDM) JM EPDM Peel & Stick Flashing

### Description

JM EPDM Peel & Stick Flashing is a 6" (15.24 cm) or 12" (30.48 cm) wide, uncured EPDM (ethylene propylene diene monomer) sheet with a diamond texture on the top side with a release liner and a factory laminated, self-adhering EPDM/butyl tape. This product is formulated to provide high initial strength in both peel and shear at typical rooftop temperatures. It also improves the speed and quality of flashings on JM EPDM roofing systems.

### Use

To easily form flashings around corners and irregular penetrations. Specifically designed for use in areas that cannot be properly handled with cured EPDM membrane. A peel and stick product is often used as an alternative to solvent-based contact adhesives.

### Color

Black

### Physical Properties

#### Thickness

Membrane Thickness	0.060" (1.83 mm)
Tape Thickness	0.025" (0.76 mm)
Total Thickness	0.085" (2.59 mm)

### Packaging

#### 6" (15.24 cm) Peel & Stick Flashing

2 rolls/box, 200 lin ft (60.96 lin m)/box  
56 lb (22.6 kg)/box

#### 12" (30.48 cm) Peel & Stick Flashing

1 roll/box, 50 lin ft (15.24 lin m)/box  
28 lb (12.7 kg)/box

### Roll Sizes


6" x 100' (15.24 cm x 30.48 m)  
12" x 50' (30.48 cm x 15.24 m)

### Shelf Life

Six months when stored properly (see storage section). Storage temperatures exceeding 90°F (32°C) may affect shelf life.

### Storage

Keep product clean and dry prior to application. Store indoors, out of direct sunlight, at temperatures between 60°F and 80°F (16°C and 27°C).

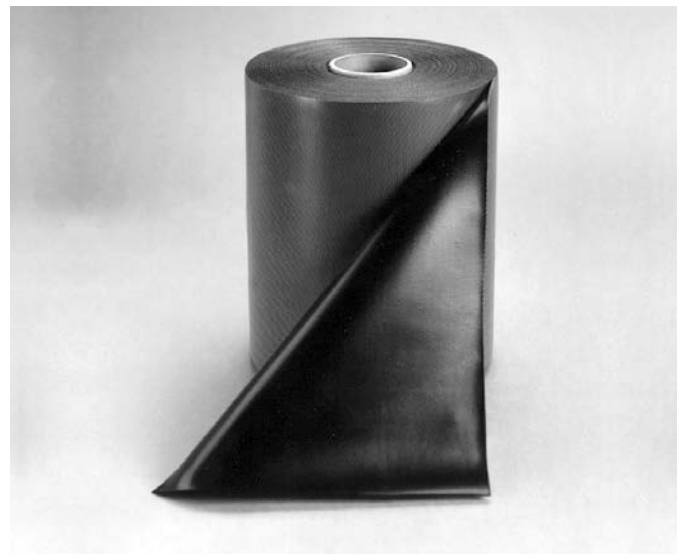

### Application

In temperatures below 40°F (4°C), the use of supplemental heat is recommended for certain applications.

Ensure the surface to be flashed is clean prior to application. If the membrane is dirty or has been installed for more than one month, clean the membrane prior to installation with JM EPDM Splice Cleaner. Be sure to wear solvent-resistant gloves. Apply the JM EPDM Splice Cleaner using a scrubbing pad. Work the cleaner into the surface of the membrane to remove all foreign material. Wipe the scrubbed surface with a dry, clean rag before the surface has completely dried.

Next, using a scrubbing pad, apply JM EPDM Tape Primer/Wash to the cleaned area at a rate of 350 ft<sup>2</sup> to 400 ft<sup>2</sup>/gal (8.6 m<sup>2</sup> to 9.8 m<sup>2</sup>/l). Apply JM EPDM Tape Primer/Wash past the marked area and allow to dry thoroughly prior to application of tape products.

Refer to JM EPDM Applicator Guides or Detail Drawings for instructions.

### Precautions

**Do not install in direct contact with asphalt or coal tar pitch.**

**Refer to the Material Safety Data Sheet prior to using**

**JM EPDM Peel & Stick Flashing. Material Safety Data Sheet is available by calling (800) 922-5922 or on the Web at [www.jm.com/roofing](http://www.jm.com/roofing).**